

**A07335 ZEP HI PRES LUBE R07101 20N13**

Version 4.3

Revision Date 03/01/2018

Print Date 02/19/2020

**SECTION 1. PRODUCT AND COMPANY IDENTIFICATION**

Material name : A07335 ZEP HI PRES LUBE R07101 20N13

Material number : 000000000001040951

**Manufacturer or supplier's details**

Company : Zep Inc.

Address : 350 Joe Frank Harris Parkway, SE  
Emerson, GA 30137

Telephone : 404-352-1680

**Emergency telephone numbers****For SDS Information** : Compliance Services 1-877-428-9937**For a Medical Emergency** : 877-541-2016 Toll Free - All Calls Recorded**For a Transportation Emergency** : CHEMTREC: 800-424-9300 - All Calls Recorded.  
In the District of Columbia 202-483-7616**Recommended use of the chemical and restrictions on use**

Recommended use : Lubricant

**SECTION 2. HAZARDS IDENTIFICATION****Emergency Overview**

Appearance	Aerosol containing a liquefied gas
Colour	amber, clear
Odour	solvent-like

**GHS Classification**Flammable aerosols : Category 1  
Gases under pressure : Liquefied gas  
Skin irritation : Category 2  
Specific target organ toxicity - single exposure : Category 3 (Central nervous system)**GHS label elements**

Hazard pictograms :



Signal word : Danger

Hazard statements : H222 Extremely flammable aerosol.  
H280 Contains gas under pressure; may explode if heated.  
H315 Causes skin irritation.  
H336 May cause drowsiness or dizziness.Precautionary statements : **Prevention:**

**A07335 ZEP HI PRES LUBE R07101 20N13**

Version 4.3

Revision Date 03/01/2018

Print Date 02/19/2020

P210 Keep away from heat/sparks/open flames/hot surfaces.  
No smoking.  
P211 Do not spray on an open flame or other ignition source.  
P251 Pressurized container: Do not pierce or burn, even after use.  
P261 Avoid breathing dust/ fume/ gas/ mist/ vapours/ spray.  
P264 Wash skin thoroughly after handling.  
P271 Use only outdoors or in a well-ventilated area.  
P280 Wear protective gloves.

**Response:**

P302 + P352 IF ON SKIN: Wash with plenty of soap and water.  
P304 + P340 + P312 IF INHALED: Remove person to fresh air and keep comfortable for breathing. Call a POISON CENTER/doctor if you feel unwell.  
P332 + P313 If skin irritation occurs: Get medical advice/attention.  
P362 Take off contaminated clothing and wash before reuse.

**Storage:**

P410 + P412 Protect from sunlight. Do not expose to temperatures exceeding 50 °C/ 122 °F.  
P403 Store in a well-ventilated place.

**Disposal:**

P501 Dispose of contents/container in accordance with local regulation.

**SECTION 3. COMPOSITION/INFORMATION ON INGREDIENTS**

Substance / Mixture : Mixture

**Hazardous components**

Chemical name	CAS-No.	Concentration [%]
Naphtha (petroleum), hydrotreated light	64742-49-0	>= 20 - < 30
propane	74-98-6	>= 10 - < 20
butane	106-97-8	>= 10 - < 20
Distillates (petroleum), hydrotreated light	64742-47-8	>= 1 - < 5
heptane	142-82-5	>= 1 - < 5

The exact percentages of disclosed substances are withheld as trade secrets.

**SECTION 4. FIRST AID MEASURES**

General advice : Move out of dangerous area.  
Show this safety data sheet to the doctor in attendance.  
Do not leave the victim unattended.

If inhaled : Consult a physician after significant exposure.  
If unconscious, place in recovery position and seek medical advice.

In case of skin contact : Wash off immediately with plenty of water for at least 15 minutes.  
Remove contaminated clothing and shoes.  
Wash contaminated clothing before reuse.  
If skin irritation persists, call a physician.

**A07335 ZEP HI PRES LUBE R07101 20N13**

Version 4.3

Revision Date 03/01/2018

Print Date 02/19/2020

- In case of eye contact : Remove contact lenses.  
Protect unharmed eye.  
Keep eye wide open while rinsing.  
Rinse immediately with plenty of water, also under the eyelids, for at least 15 minutes.  
If in eyes, rinse with water for 15 minutes.
- If swallowed : Keep respiratory tract clear.  
Never give anything by mouth to an unconscious person.  
If symptoms persist, call a physician.  
DO NOT induce vomiting unless directed to do so by a physician or poison control center.
- Most important symptoms and effects, both acute and delayed : Effects are immediate and delayed.  
Symptoms may include irritation, redness, pain, and rash.  
Effects are dependent on exposure (dose, concentration, contact time).  
Symptoms of overexposure may include disorientation; dizziness; and confusion. May progress to unconsciousness, paralysis, and convulsions.  
  
May cause drowsiness or dizziness.  
Causes skin irritation.  
Review section 2 of SDS to see all potential hazards.
- Notes to physician : Treat symptomatically. Symptoms may be delayed.

---

**SECTION 5. FIREFIGHTING MEASURES**

- Suitable extinguishing media : Alcohol-resistant foam  
Carbon dioxide (CO<sub>2</sub>)  
Dry chemical
- Unsuitable extinguishing media : High volume water jet
- Specific hazards during firefighting : Do not allow run-off from fire fighting to enter drains or water courses.
- Hazardous combustion products : Carbon dioxide (CO<sub>2</sub>)  
Carbon monoxide  
Smoke
- Specific extinguishing methods : Use extinguishing measures that are appropriate to local circumstances and the surrounding environment.
- Further information : Collect contaminated fire extinguishing water separately. This must not be discharged into drains.  
Fire residues and contaminated fire extinguishing water must be disposed of in accordance with local regulations.  
For safety reasons in case of fire, cans should be stored separately in closed containments.  
Use a water spray to cool fully closed containers.

**A07335 ZEP HI PRES LUBE R07101 20N13**

Version 4.3

Revision Date 03/01/2018

Print Date 02/19/2020

Special protective equipment for firefighters : Wear self-contained breathing apparatus for firefighting if necessary.

---

**SECTION 6. ACCIDENTAL RELEASE MEASURES**

Personal precautions, protective equipment and emergency procedures : Use personal protective equipment.  
Ensure adequate ventilation.  
Remove all sources of ignition.  
Evacuate personnel to safe areas.  
Beware of vapours accumulating to form explosive concentrations. Vapours can accumulate in low areas.

Environmental precautions : Prevent product from entering drains.  
Prevent further leakage or spillage if safe to do so.  
If the product contaminates rivers and lakes or drains inform respective authorities.

Methods and materials for containment and cleaning up : Soak up with inert absorbent material (e.g. sand, silica gel, acid binder, universal binder, sawdust).  
Sweep up or vacuum up spillage and collect in suitable container for disposal.

---

**SECTION 7. HANDLING AND STORAGE**

Advice on safe handling : Do not breathe vapours or spray mist.  
Avoid exposure - obtain special instructions before use.  
Avoid contact with skin and eyes.  
For personal protection see section 8.  
Smoking, eating and drinking should be prohibited in the application area.  
Take precautionary measures against static discharges.  
Provide sufficient air exchange and/or exhaust in work rooms.  
Dispose of rinse water in accordance with local and national regulations.  
Always replace cap after use.

Conditions for safe storage : BEWARE: Aerosol is pressurized. Keep away from direct sun exposure and temperatures over 50 °C. Do not open by force or throw into fire even after use. Do not spray on flames or red-hot objects.  
No smoking.  
Keep in a dry, cool and well-ventilated place.  
Observe label precautions.  
Electrical installations / working materials must comply with the technological safety standards.

Materials to avoid : Strong oxidizing agents

---

**SECTION 8. EXPOSURE CONTROLS/PERSONAL PROTECTION****Components with workplace control parameters**

## A07335 ZEP HI PRES LUBE R07101 20N13

Version 4.3

Revision Date 03/01/2018

Print Date 02/19/2020

Components	CAS-No.	Value type (Form of exposure)	Control parameters / Permissible concentration	Basis
propane	74-98-6	TWA	1,000 ppm	ACGIH
		TWA	1,000 ppm 1,800 mg/m3	NIOSH REL
		TWA	1,000 ppm 1,800 mg/m3	OSHA Z-1
		TWA	1,000 ppm 1,800 mg/m3	OSHA P0
		PEL	1,000 ppm 1,800 mg/m3	CAL PEL
butane	106-97-8	TWA	800 ppm 1,900 mg/m3	NIOSH REL
		TWA	800 ppm 1,900 mg/m3	OSHA P0
		PEL	800 ppm 1,900 mg/m3	CAL PEL
Distillates (petroleum), hydrotreated light	64742-47-8	TWA	500 ppm 2,000 mg/m3	OSHA Z-1
		TWA	400 ppm 1,600 mg/m3	OSHA P0
		TWA (Mist)	5 mg/m3	OSHA Z-1
		TWA (Mist)	5 mg/m3	OSHA P0
		TWA (Mist)	5 mg/m3	NIOSH REL
		ST (Mist)	10 mg/m3	NIOSH REL
		PEL (particulate)	5 mg/m3	CAL PEL
heptane	142-82-5	TWA	85 ppm 350 mg/m3	NIOSH REL
		C	440 ppm 1,800 mg/m3	NIOSH REL
		TWA	500 ppm 2,000 mg/m3	OSHA Z-1
		TWA	400 ppm 1,600 mg/m3	OSHA P0
		STEL	500 ppm 2,000 mg/m3	OSHA P0
		PEL	400 ppm 1,600 mg/m3	CAL PEL
		STEL	500 ppm 2,000 mg/m3	CAL PEL
		TWA	400 ppm	ACGIH
		STEL	500 ppm	ACGIH

**Engineering measures** : effective ventilation in all processing areas

**Personal protective equipment**

Respiratory protection : Use respiratory protection unless adequate local exhaust ventilation is provided or exposure assessment demonstrates that exposures are within recommended exposure guidelines.

**A07335 ZEP HI PRES LUBE R07101 20N13**

Version 4.3

Revision Date 03/01/2018

Print Date 02/19/2020

Hand protection	
Material	: Protective gloves
Remarks	: The suitability for a specific workplace should be discussed with the producers of the protective gloves.
Eye protection	: Safety glasses Access to clean water to rinse eyes must be available, options include: eye wash stations or showers, or eye wash bottles with pure water.
Skin and body protection	: Impervious clothing Choose body protection according to the amount and concentration of the dangerous substance at the work place.
Hygiene measures	: When using do not eat or drink. When using do not smoke. Wash hands before breaks and immediately after handling the product.

**SECTION 9. PHYSICAL AND CHEMICAL PROPERTIES**

Appearance	: Aerosol containing a liquefied gas
Colour	: amber, clear
Odour	: solvent-like
Odour Threshold	: No data available
pH	: Not applicable
Melting point/freezing point	: Not applicable
Boiling point	: No data available
Flash point	: Not applicable
Evaporation rate	: > 1
Flammability (solid, gas)	: Extremely flammable aerosol.
Upper explosion limit	: No data available
Lower explosion limit	: No data available
Vapour pressure	: No data available
Relative vapour density	: No data available
Density	: 0.75 g/cm <sup>3</sup>
Solubility(ies)	
Water solubility	: insoluble
Partition coefficient: n-octanol/water	: No data available
Auto-ignition temperature	: not determined

**A07335 ZEP HI PRES LUBE R07101 20N13**

Version 4.3

Revision Date 03/01/2018

Print Date 02/19/2020

Thermal decomposition : No data available

Viscosity

Viscosity, kinematic : No data available

Heat of combustion : 31.21 kJ/g

---

**SECTION 10. STABILITY AND REACTIVITY**

Reactivity : Stable

Chemical stability : Stable under normal conditions.

Possibility of hazardous reactions : Vapours may form explosive mixture with air.  
No decomposition if stored and applied as directed.Conditions to avoid : Heat, flames and sparks.  
Extremes of temperature and direct sunlight.

Incompatible materials : Strong oxidizing agents

Hazardous decomposition products : Carbon monoxide, carbon dioxide and unburned hydrocarbons (smoke).

---

**SECTION 11. TOXICOLOGICAL INFORMATION****Potential Health Effects**

Aggravated Medical Condition : None known.

Symptoms of Overexposure : Effects are immediate and delayed.  
Symptoms may include irritation, redness, pain, and rash.  
Effects are dependent on exposure (dose, concentration, contact time).  
Symptoms of overexposure may include disorientation; dizziness; and confusion. May progress to unconsciousness, paralysis, and convulsions.**Carcinogenicity:****IARC**

No component of this product present at levels greater than or equal to 0.1% is identified as probable, possible or confirmed human carcinogen by IARC.

**ACGIH**

No component of this product present at levels greater than or equal to 0.1% is identified as a carcinogen or potential carcinogen by ACGIH.

**OSHA**

No component of this product present at levels greater than or equal to 0.1% is on OSHA's list of regulated carcinogens.

**A07335 ZEP HI PRES LUBE R07101 20N13**

Version 4.3

Revision Date 03/01/2018

Print Date 02/19/2020

**NTP**

No component of this product present at levels greater than or equal to 0.1% is identified as a known or anticipated carcinogen by NTP.

**Acute toxicity****Product:**

Acute dermal toxicity : Acute toxicity estimate : > 5,000 mg/kg  
Method: Calculation method

**Components:****Distillates (petroleum), hydrotreated light:**

Acute oral toxicity : LD50 Rat: > 5,000 mg/kg

Acute inhalation toxicity : LC50 Rat: > 4.6 mg/l  
Exposure time: 6 h

Acute dermal toxicity : LD50 Rat: > 2,000 mg/kg

**heptane:**

Acute inhalation toxicity : LC50 Rat: 103 mg/l  
Exposure time: 4 h

**Skin corrosion/irritation****Product:**

Remarks: Irritating to skin.

**Serious eye damage/eye irritation****Product:**

Remarks: May irritate eyes.

**Respiratory or skin sensitisation**

No data available

**Germ cell mutagenicity**

No data available

**Carcinogenicity**

No data available

**Reproductive toxicity**

No data available

**STOT - single exposure**

No data available

**STOT - repeated exposure**

No data available



**A07335 ZEP HI PRES LUBE R07101 20N13**

Version 4.3

Revision Date 03/01/2018

Print Date 02/19/2020

**Aspiration toxicity**

No data available

**Further information****Product:**

Remarks: Symptoms of overexposure may be headache, dizziness, tiredness, nausea and vomiting., Concentrations substantially above the TLV value may cause narcotic effects., Solvents may degrease the skin.

**Components:****Distillates (petroleum), hydrotreated light:**

Remarks: No data available

---

**SECTION 12. ECOLOGICAL INFORMATION****Ecotoxicity**

No data available

**Persistence and degradability**

No data available

**Bioaccumulative potential****Product:**

Partition coefficient: n-octanol/water : Remarks: No data available

**Components:****butane :**

Partition coefficient: n-octanol/water : Pow: 2.89

**heptane :**

Partition coefficient: n-octanol/water : log Pow: 5

**Mobility in soil**

No data available

**Other adverse effects**

No data available

**Product:**

Regulation

40 CFR Protection of Environment; Part 82 Protection of Stratospheric Ozone - CAA Section 602 Class I Substances

Remarks

This product neither contains, nor was manufactured with a Class I or Class II ODS as defined by the U.S. Clean Air Act Section 602 (40 CFR 82, Subpt. A, App.A + B).

**A07335 ZEP HI PRES LUBE R07101 20N13**

Version 4.3

Revision Date 03/01/2018

Print Date 02/19/2020

Additional ecological information : No data available

**Components:****Distillates (petroleum), hydrotreated light :**

Additional ecological information : No data available

---

**SECTION 13. DISPOSAL CONSIDERATIONS****Disposal methods**

- Waste from residues : The product should not be allowed to enter drains, water courses or the soil.  
Do not contaminate ponds, waterways or ditches with chemical or used container.  
Dispose of in accordance with local regulations.
- Contaminated packaging : Empty remaining contents.  
Dispose of as unused product.  
Do not re-use empty containers.  
Do not burn, or use a cutting torch on, the empty drum.

---

**SECTION 14. TRANSPORT INFORMATION**

Transportation Regulation: 49 CFR (USA):  
UN1950, Aerosols, flammable, 2.1, - Limited quantity

Transportation Regulation: IMDG (Vessel):  
UN1950, AEROSOLS, 2.1, - Limited quantity

Transportation Regulation: IATA (Cargo Air):  
UN1950, Aerosols, flammable, 2.1, - Limited quantity

Transportation Regulation: IATA (Passenger Air):  
UN1950, Aerosols, flammable, 2.1, - Limited quantity

Transportation Regulation: TDG (Canada):  
UN1950, AEROSOLS, FLAMMABLE, 2.1, - Limited quantity

The product as delivered to the customer conforms to packaging requirements for shipment by road under US Department of Transportation (DOT) regulations. Additional transportation classifications noted above are for reference only, and not a certification or warranty of the suitability of the packaging for shipment under these alternative transport regulations.

---

**SECTION 15. REGULATORY INFORMATION**

**A07335 ZEP HI PRES LUBE R07101 20N13**

Version 4.3

Revision Date 03/01/2018

Print Date 02/19/2020

**TSCA list** : No substances are subject to a Significant New Use Rule.

No substances are subject to TSCA 12(b) export notification requirements.

**EPCRA - Emergency Planning and Community Right-to-Know Act****CERCLA Reportable Quantity**

Components	CAS-No.	Component RQ (lbs)	Calculated product RQ (lbs)
toluene	108-88-3	1000	*

\*: Calculated RQ exceeds reasonably attainable upper limit.

**SARA 304 Extremely Hazardous Substances Reportable Quantity**

This material does not contain any components with a section 304 EHS RQ.

**SARA 311/312 Hazards** : Flammable (gases, aerosols, liquids, or solids)  
Gases under pressure  
Skin corrosion or irritation  
Specific target organ toxicity (single or repeated exposure)**SARA 302** : No chemicals in this material are subject to the reporting requirements of SARA Title III, Section 302.**SARA 313** : This material does not contain any chemical components with known CAS numbers that exceed the threshold (De Minimis) reporting levels established by SARA Title III, Section 313.**California Prop. 65**WARNING: This product can expose you to chemicals including toluene, which is/are known to the State of California to cause birth defects or other reproductive harm. For more information go to [www.P65Warnings.ca.gov](http://www.P65Warnings.ca.gov).**The components of this product are reported in the following inventories:****DSL** This product contains one or more components that are listed on the Canadian NDSL. All other components are on the Canadian DSL.  
**TSCA** On TSCA Inventory

For information on the country notification status for other regions please contact the manufacturer's regulatory group.

**Inventory Acronym and Validity Area Legend:**

TSCA (USA), DSL (Canada), NDSL (Canada)

## A07335 ZEP HI PRES LUBE R07101 20N13

Version 4.3


Revision Date 03/01/2018

Print Date 02/19/2020

## SECTION 16. OTHER INFORMATION

## Further information

## NFPA:

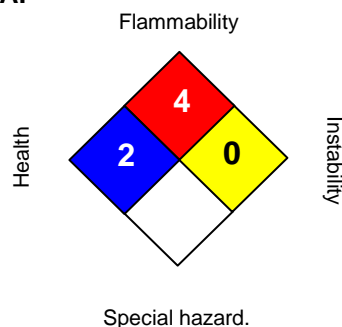


## HMIS III:

HEALTH	2
FLAMMABILITY	4
PHYSICAL HAZARD	2

0 = not significant, 1 = Slight,  
2 = Moderate, 3 = High  
4 = Extreme, \* = Chronic

## OSHA - GHS Label Information:

Hazard pictograms

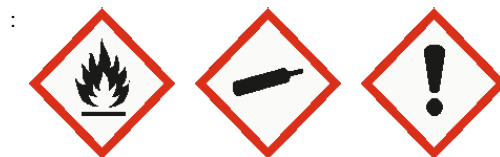

Signal word

: **Danger:**

Hazard statements

: Extremely flammable aerosol. Contains gas under pressure; may explode if heated. Causes skin irritation. May cause drowsiness or dizziness.

Precautionary statements

**Prevention:** Keep away from heat/sparks/open flames/hot surfaces. No smoking. Do not spray on an open flame or other ignition source. Pressurized container: Do not pierce or burn, even after use. Avoid breathing dust/ fume/ gas/ mist/ vapours/ spray. Wash skin thoroughly after handling. Use only outdoors or in a well-ventilated area. Wear protective gloves.

**Response:** IF ON SKIN: Wash with plenty of soap and water. IF INHALED: Remove person to fresh air and keep comfortable for breathing. Call a POISON CENTER/doctor if you feel unwell. If skin irritation occurs: Get medical advice/ attention. Take off contaminated clothing and wash before reuse.

**Storage:** Protect from sunlight. Do not expose to temperatures exceeding 50 °C/ 122 °F. Store in a well-ventilated place.

**Disposal:** Dispose of contents/container in accordance with local regulation.

Version:	4.3
Revision Date:	03/01/2018
Print Date:	02/19/2020

We believe the statements, technical information and recommendations contained herein are reliable, but they are given without warranty or guarantee of any kind. The information in this document applies to this specific material as supplied. It may not be valid for this material if it is used in combination with any other materials. Users should make their own investigations to determine the suitability and applicability of the information for their particular purposes. This SDS has been prepared by the Compliance Services organization supporting this manufacturer, supplier or distributor.

**A07335 ZEP HI PRES LUBE R07101 20N13**

Version 4.3

Revision Date 03/01/2018

Print Date 02/19/2020

Zep Inc. markets products under well recognized and established brand names such as Zep®, Zep Commercial®, Zep Professional®, Enforcer®, National Chemical™, Selig™, Misty®, Next Dimension™, Petro®, i-Chem®, TimeMist®, TimeWick™, MicrobeMax®, Country Vet®, Konk®, Original Bike Spirits®, Blue Coral®, Black Magic®, Rain-X®, Niagara National™, FC Forward Chemicals®, Rexodan®, Mykal™, and a number of private labeled brands.